

DEPARTMENT OF PARKS AND RECREATION
OFFICE OF HISTORIC PRESERVATION

HISTORIC RESOURCES INVENTORY

IDENTIFICATION AND LOCATION

1. Historic name Kaliski, Louis, Building-or-The Marti-Rae Apartments

Ser. No. _____
National Register status _____
Local designation _____

* 2. Common or current name None

* 3. Number & street 1335-1339 Park St./2321-2325 Alameda Ave. Cross-corridor _____
City Alameda Vicinity only _____ Zip 94501 County Alameda

4. UTM zone 10 A 566720/4179640 B _____ C _____ D _____

5. Quad map No. 4653 Parcel No. 71-204-11 Other _____

DESCRIPTION

6. Property category Building If district, number of documented resources _____

* 7. Briefly describe the present physical appearance of the property, including condition, boundaries, related features, surroundings, and (if appropriate) architectural style.

This two-story commercial/apartment building, of reinforced-concrete construction, is located at the northwest corner of Park Street and Alameda Avenue, with the principal facades facing east to Park Street and south to Alameda Avenue. The building contains seven commercial spaces at street level (consolidated into five) and eight apartments on the upper story. It is of reinforced-concrete construction; the unadorned north side and rear display painted concrete. The building has a rectangular plan measuring approximately 50' x 120', with the long side facing Alameda Ave. The level roof is concealed behind parapets. The street facades are clad in smooth cement stucco and adorned with cast-concrete ornament (pilasters, frieze, coping, parapet panels) based on Renaissance/Baroque sources. The symmetrical Park Street facade displays heavy ornament with a floral/shield motif on the storefront frieze and on the high central parapet panel (containing a shield with the letter "K"). Smaller and simpler panels flanking the central panel continue along the Alameda Avenue facade, interspersed with a second type of panel. The upper story contains tripartite and double-hung windows, the former more numerous, the latter of varying size. The tripartite windows (narrow casements flanking a wide double-hung section) have applied lathed ornament on vertical members; casements and upper lights of double-hung windows are adorned with thin mullions in a variety of patterns. End bays are accentuated by bar molding and by recessed panels highlighted with black and yellow ceramic tile. The four original storefronts along Alameda Avenue have recessed entries with mosaic tile paving and display windows with black and yellow ceramic tile in a checkerboard pattern; the recessed apartment entry (2323 Alameda Ave.) is bordered in similar ceramic tile, with a larger polychrome tile over the entry depicting jousting knights. Of the three Park Street storefronts, two (1335 and 1337) have been rebuilt; the third (1339) retains a central recessed entry flanked by display windows with green marble base. All storefront transoms have been stuccoed over. Two interiors (1337 and 1339) are largely intact, each with a high ceiling and an open mezzanine with twin arches springing from a short, tapering post with Ionic capital.



8. Planning agency
City Planning Department

9. Owner & address
Italo A. Calpestri, III
1035 San Pablo Ave.
Suite 12
Albany, CA 94706

10. Type of ownership Private

11. Present use Commercial/residential

12. Zoning C-2

13. Threats None

A 94296-0001

All items must be completed for historical resources

HISTORICAL INFORMATION

- *14. Construction date(s) 1925 F Original location Same Date moved _____
15. Alterations & date Storefronts at 1335 & 1337 Park St. rebuilt; all storefront transoms stuccoed over (1960s)
16. Architect Alexander A. Cantin Builder Conrad Roth
17. Historic attributes (with number from list) 06 - Commercial Building; 03 - Apartment Building

SIGNIFICANCE AND EVALUATION

18. Context for evaluation: Theme Commercial Development Area Alameda
 Period 1864-1944 Property type Commercial/Apartment Building Context formally developed? Yes
- *19. Briefly discuss the property's importance within the context. Use historical and architectural analysis as appropriate. Compare with similar properties.

Louis Kaliski was a local investor who developed several properties in the Park street area in the 1920s (see 1320-1328 Park Street), including this commercial/apartment building. Designed by San Francisco architect A.A. Cantin, it was built in 1925 at a cost of \$25,000 by Alameda contractor Conrad Roth (Cantin and Roth designed and built Kaliski's other local buildings as well). A wide variety of commercial tenants have occupied the ground floor spaces. The upstairs apartments went by the name of the Beverley Apartments as early as 1927, although on the plans the building is called the Marti-Rae Apartments. This building is a fine example of eclectic commercial architecture of its period retaining a high degree of integrity. It is a contributor to the Park Street Historic Commercial District (National Register, 1982).

20. Sources

Assessor's Books; Building Permits; City Directories; Sanborn Map Books
Alameda Times-Star (1-19-1925)

Plans (blueprints, 6 sheets, dated Jan. 1925; on file in attic of Alameda City Hall).

21. Applicable National Register criteria A, C

22. Other recognition _____

State Landmark No. (if applicable) _____

23. Evaluator Keeper

Date of evaluation 1982

24. Survey type PR

25. Survey name Commercial Buildings (1992 CLG)

- *26. Year form prepared 1992

By (name) Woodruff C. Minor


Organization Alameda City Planning Department

Address City Hall, Oak St. & Santa Clara Av.


City & Zip Alameda 94501

Phone 1-510-748-4554

* Sketch map. Show location and boundaries of property in relation to nearby streets, railways, natural landmarks, etc. Name each feature.

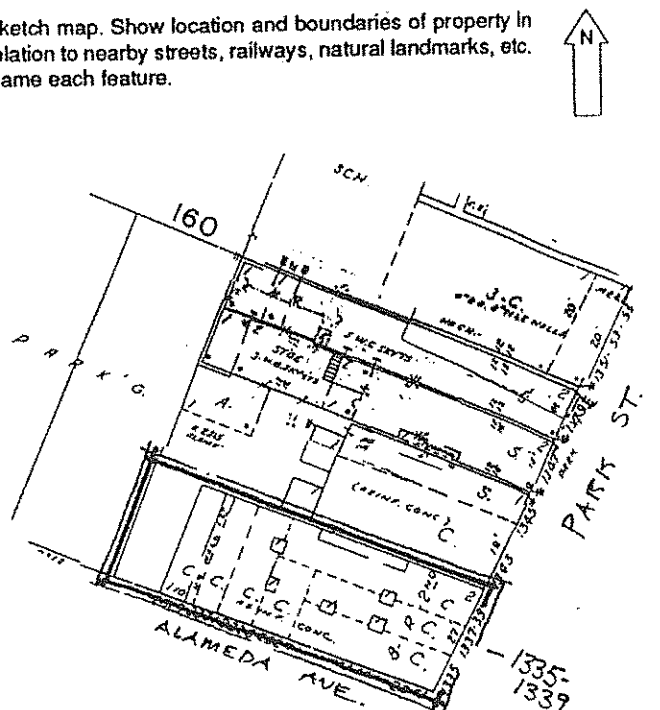

11 PRESERVATION BRIEFS

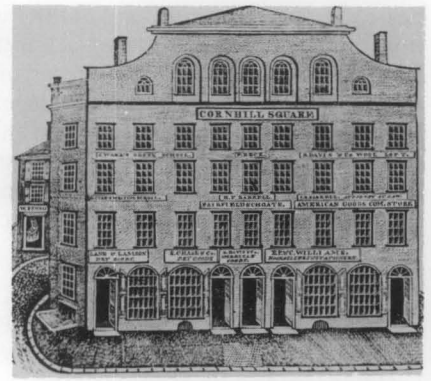

Rehabilitating Historic Storefronts

H. Ward Jandl



U.S. Department of the Interior
National Park Service
Cultural Resources
Heritage Preservation Services

The storefront is the most important architectural feature of many historic commercial buildings. It also plays a crucial role in a store's advertising and merchandising strategy to draw customers and increase business. Not surprisingly, then, the storefront has become the feature most commonly altered in a historic commercial building. In the process, these alterations may have completely changed or destroyed a building's distinguishing architectural features that make up its historic character.

As more and more people come to recognize and appreciate the architectural heritage of America's downtowns, however, a growing interest can be seen in preserving the historic character of commercial buildings. The sensitive rehabilitation of storefronts can result not only in increased business for the owner but can also provide evidence that downtown revitalization efforts are succeeding (see figure 1).

Once a decision is made to rehabilitate a historic commercial building, a series of complex decisions faces the owner, among them:

- if the original storefront has survived largely intact but is in a deteriorated condition, what repairs should be undertaken?
- if the storefront has been modernized at a later date, should the later alterations be kept or the building restored to its original appearance or an entirely new design chosen?
- if the building's original retail use is to be changed to office or residential, can the commercial appearance of the building be retained while accommodating the new use?

This Preservation Brief is intended to assist owners, architects, and planning officials in answering such questions about how to evaluate and preserve the character of historic storefronts. In so doing, it not only addresses the

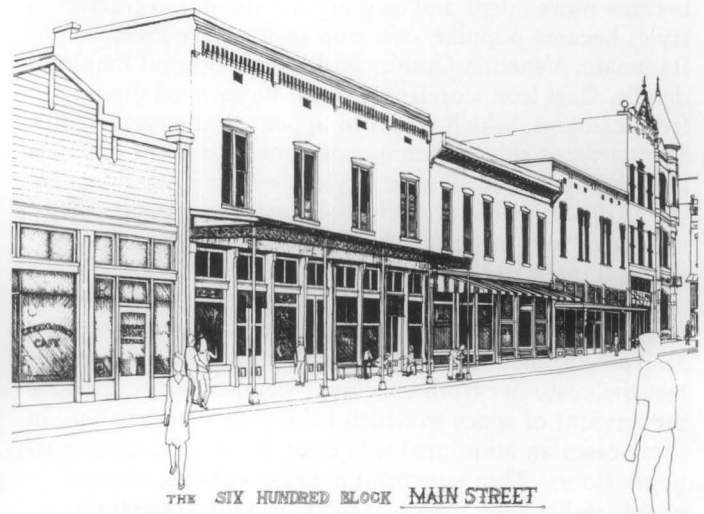


Figure 1. Inappropriate storefront alterations over the years—metal cladding, oversized signs and canopies—have detracted from the character of this historic district in Van Buren, Arkansas. A carefully considered rehabilitation plan for Main Street, including the removal of poorly designed signs, false fronts and the selection of an appropriate exterior paint color palette, serves to enhance the visual environment and preserves the district's sense of time and place. Photo above: Bob Dunn; Drawing, David Fitts

basic design issues associated with storefront rehabilitation, but recommends preservation treatments as well. Finally, although the Brief focuses on storefront rehabilitation, it is important to review this specific work in the broader context of preserving and maintaining the overall structure. Money spent on storefront rehabilitation may be completely wasted if repair and maintenance problems on the rest of the building are neglected.

Historical Overview

Commercial establishments of the 18th and early 19th centuries were frequently located on the ground floor of buildings and, with their residentially scaled windows and doors, were often indistinguishable from surrounding houses. In some cases, however, large bay or oriel windows comprised of small panes of glass set the shops apart from their neighbors. Awnings of wood and canvas and signs over the sidewalk were other design features seen on some early commercial buildings. The ground floors of large commercial establishments, especially in the first decades of the 19th century, were distinguished by regularly spaced, heavy piers of stone or brick, infilled with paneled doors or small paned window sash. Entrances were an integral component of the facade, typically not given any particular prominence although sometimes wider than other openings.

The ready availability of architectural cast iron after the 1840's helped transform storefront design as architects and builders began to experiment using iron columns and lintels at the ground floor level. Simultaneous advances in the glass industry permitted manufacturing of large panes of glass at a reasonable cost. The combination of these two technical achievements led to the storefront as we know it today—large expanses of glass framed by thin structural elements. The advertisement of the merchant and his products in the building facade and display windows quickly became critical factors in the competitive commercial atmosphere of downtowns. In the grouping of these wide-windowed facades along major commercial streets, the image of America's cities and towns radically changed.

The first cast iron fronts were simple post-and-lintel construction with little decoration. As iron craftsmen became more adept and as more ornate architectural styles became popular, cast iron fronts were given Italianate, Venetian Gothic, and French Second Empire details. Cast iron storefronts could be selected directly from catalogs, which began to appear in the early 1850's. Standardized sills, columns, and lintels could be arranged to create fronts of all sizes, styles and configurations. In the 1870's sheet metal storefronts became popular; they were also sold in standardized sizes and configurations through manufacturers' catalogs (see figure 2).

The typical 19th century storefront consisted of single or double doors flanked by display windows (see figure 3). The entrance was frequently recessed, not only to protect the customer from inclement weather but to increase the amount of space in which to display merchandise. In some cases an additional side door provided access to the upper floors. Thin structural members of cast iron or wood, rather than masonry piers, usually framed the storefront. The windows themselves were raised off the ground by wood, cast iron or pressed metal panels or bulkheads; frequently, a transom or series of transoms (consisting of single or multiple panes of glass) were

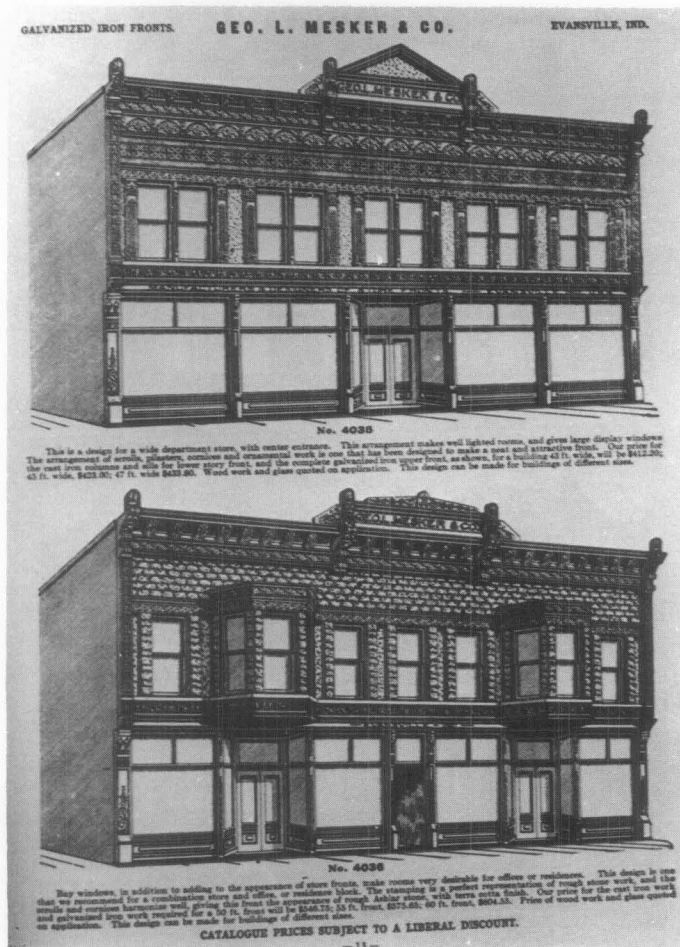


Figure 2. These 19th century galvanized iron storefronts could be purchased from George L. Mesker & Co. in Evansville, Indiana.

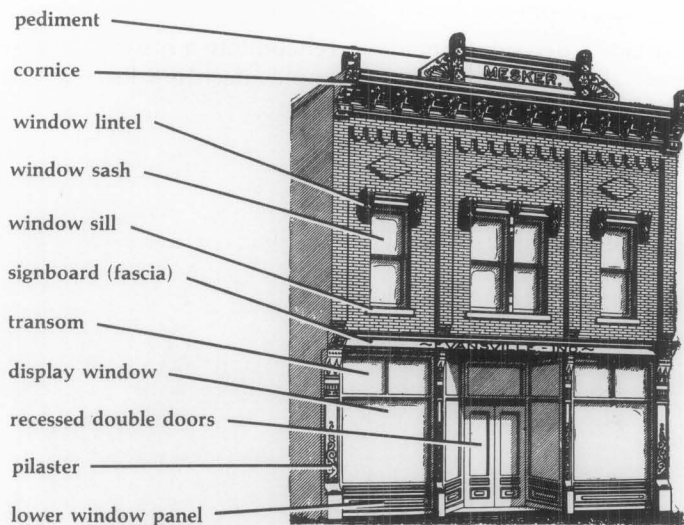


Figure 3. Become familiar with the architectural features typical of historic commercial buildings. A close look at a storefront's construction materials, features and relationship to the upper stories will help in determining how much of the original facade remains.

This particular storefront is No. 4016 in the George L. Mesker and Company catalog of 1905. One of Mesker's most popular designs, it featured cast-iron sills, columns and lintels, galvanized iron lintel and main cornice, window caps and pediment.

placed above each window and door. The signboard above the storefront (the fascia covering the structural beam) became a prominent part of the building. Canvas awnings, or in some cases tin or wooden canopies, often shaded storefronts of the late 19th century. Iron fronts were frequently put onto existing buildings as a way of giving them an up-to-date appearance. Except for expanding the display window area to the maximum extent possible and the increasing use of canvas awnings, few major technical innovations in storefront design can be detected from the 1850's through 1900.

The first decades of the 20th century saw the growing use of decorative transom lights (often using small prismatic glass panes) above display windows; in some cases, these transoms could be opened to permit air circulation into the store. Electric incandescent lights enabled storeowners to call attention to their entrance and display windows and permitted nighttime shopping. In the 1920's and 1930's a variety of new materials were introduced into the storefront, including aluminum and stainless steel framing elements, pigmented structural glass (in a wide variety of colors), tinted and mirrored glass, glass block and neon. A bewildering number of proprietary products also appeared during this period, many of which went into storefronts including Aklo, Vitrolux, Vitrolite, and Extrudalite. Highly colored and heavily patterned marble was a popular material for the more expensive storefronts of this period. Many experiments were made with recessed entries, floating display islands, and curved glass. The utilization of neon lighting further transformed store signs into elaborate flashing and blinking creations. During this period design elements were simplified and streamlined; transom and signboard were often combined. Signs utilized typefaces for the period, including such stylized lettering as "Broadway," "Fino" and "Monogram." Larger buildings of this period, such as department stores, sometimes had fixed metal canopies, with lighting and signs as an integral component of the fascia (see figure 4).

Because commercial architecture responds to a variety of factors—environmental, cultural, and economic, distinct regional variations in storefronts can be noted. Fixed metal canopies supported by guy wires, for example, were common in late 19th and early 20th century storefronts in southern states where it was advantageous to have shaded entrances all year long. Such a detail was less common in the northeast where moveable canvas awnings predominated. These awnings could be lowered in summer to keep buildings cooler and raised in winter when sunlight helps to heat the building.

Evaluating the Storefront

The important key to a successful rehabilitation of a historic commercial building is planning and selecting treatments that are sensitive to the architectural character of the storefront. As a first step, it is therefore essential to identify and evaluate the existing storefront's construction materials; architectural features; and the relationship of those features to the upper stories (see figure 5). This evaluation will permit a better understanding of the storefront's role in, and significance to, the overall design of the building. A second and equally important step in planning the rehabilitation work is a careful examination of the storefront's physical conditions to determine the ex-

tent and nature of rehabilitation work needed (see figure 6). In most cases, this examination is best undertaken by a qualified professional.

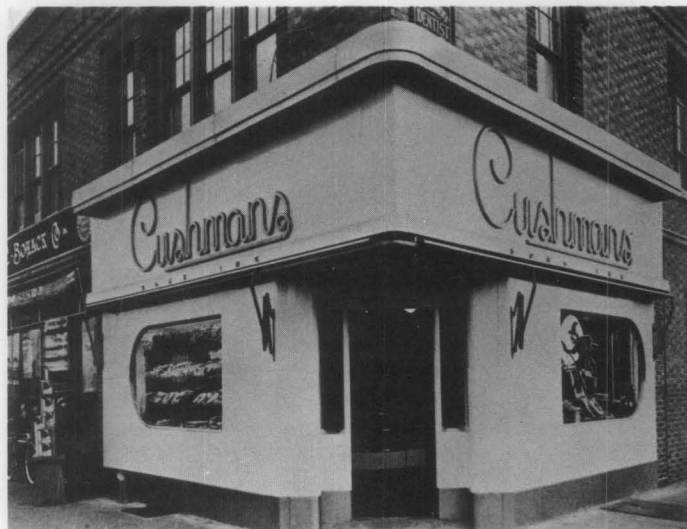


Figure 4. This storefront in New York City designed by Raymond Loewy typifies the streamlined look of the 1930's. Added to an earlier building, the front utilizes glass, stainless steel and neon to make a modern statement. This is a good example of a later storefront which has acquired significance and should be retained in any rehabilitation.



Figure 5. In some cases, as in the storefront on the extreme left, it is a simple matter to determine original appearance by looking at neighboring storefronts. Removal of the board and batten fasciabord, pent roof, and "colonial" style door, all of which could be undertaken at minimal cost, would restore the original proportions and lines of the building. Photo: Day Johnston

Guidelines for Rehabilitating Existing Historic Storefronts

1. Become familiar with the style of your building and the role of the storefront in the overall design. Don't "early up" a front. Avoid stock "lumberyard colonial" detailing such as coach lanterns, mansard overhangings, wood shakes, nonoperable shutters, and small paned windows except where they existed historically.
2. Preserve the storefront's character even though there is a new use on the interior. If less exposed window area is desirable, consider the use of interior blinds and insulating curtains rather than altering the existing historic fabric.
3. Avoid use of materials that were unavailable when the storefront was constructed; this includes vinyl and aluminum siding, anodized aluminum, mirrored or tinted glass, artificial stone, and brick veneer.
4. Choose paint colors based on the building's historical appearance. In general do not coat surfaces that have never been painted. For 19th century storefronts, contrasting colors may be appropriate, but avoid too many different colors on a single facade.



Figure 6. Storefronts of the 1940's, 50's, and 60's were frequently installed by attaching studs or a metal grid over an early front and applying new covering materials. If the existing storefront is a relatively recent addition with little or no architectural merit, begin by removing the covering materials in several places as was done here. If this preliminary investigation reveals evidence of an earlier front, such as this cast-iron column, carefully remove the later materials to assess the overall condition of the historic storefront. The black mastic visible on the lower masonry panels was used for installing pigmented structural glass. Some attachment methods for modern facings, such as mastic or metal lath, may have seriously damaged the original fabric of the building, and this must be taken into account in the rehabilitation process. Photo: Bob Dunn

The following questions should be taken into consideration in this two-part evaluation:

Construction Materials, Features, and Design Relationships

Storefront's Construction Materials: What are the construction materials? Wood? Metal? Brick or other masonry? A combination?

Storefront's Architectural Features: What are the various architectural features comprising the storefront and how are they arranged in relationship to each other?

- **Supporting Columns/Piers:**

What do the columns or piers supporting the storefront look like? Are they heavy or light in appearance? Are they flush with the windows or do they protrude? Are they all structural elements or are some columns decorative?

- **Display Windows and Transoms:**

Are the display windows and transoms single panes of glass or are they subdivided? Are they flush with the

facade or are they recessed? What is the proportion of area between the display windows and transom? Are there window openings in the base panels to allow natural light into the basement?

- **Entrances:**

Are the entrances centered? Are they recessed? Is one entrance more prominent than the others? How is the primary retail entrance differentiated from other entrances? Is there evidence that new entrances have been added or have some been relocated? Are the doors original or are they later replacements?

- **Decorative Elements:**

Are there any surviving decorative elements such as molded cornices, column capitals, fascia boards, brackets, signs, awnings or canopies? Is there a belt-course, cornice, or fascia board between the first and second floor? Are some elements older than others indicating changes over time?

Storefront's Relationship to Upper Stories: Is there a difference in materials between the storefront and upper stories? Were the storefront and floors above it created as an overall design or were they very different and unrelated to each other?

It is also worthwhile to study the neighboring commercial buildings and their distinctive characteristics to look for similarities (canopies, lighting, signs) as well as differences. This can help determine whether the storefront in question is significant and unique in its own right and/or whether it is significant as part of an overall commercial streetscape.

Physical Condition

Mild Deterioration: Do the surface materials need repair? Is paint flaking? Are metal components rusting? Do joints need recaulking where materials meet glass windows? Mild deterioration generally requires only maintenance level treatments.

Moderate Deterioration: Can rotted or rusted or broken sections of material be replaced with new material to match the old? Can solid material (such as Carrara glass) from a non-conspicuous location be used on the historic facade to repair damaged elements? Do stone or brick components need repointing? Is the storefront watertight with good flashing connections? Are there leaky gutters or air conditioner units which drip condensation on the storefront? Is caulking needed? Moderate deterioration generally requires patching or splicing of the existing elements with new pieces to match the deteriorated element.

Severe Deterioration: Have existing facing materials deteriorated beyond repair through vandalism, settlement, or water penetration? Is there a loss of structural integrity? Is the material rusted through, rotted, buckling, completely missing? Are structural lintels sagging? Are support columns settled or out of alignment? Severe deterioration generally requires replacement of deteriorated elements as part of the overall rehabilitation.

In evaluating whether the existing storefront is worthy of preservation, recognize that good design can exist in any period; a storefront added in 1930 may have greater architectural merit than what is replaced (see figure 4). In commercial historic districts, it is often the diversity of

styles and detailing that contribute to the character; removing a storefront dating from 1910 simply because other buildings in the district have been restored to their 1860's appearance may not be the best preservation approach. If the storefront design is a good example of its period and if it has gained significance over time, it should be retained as part of the historical evolution of the building (this architectural distinctiveness could also be an economic asset as it may attract attention to the building).

Deciding a Course of Action

The evaluation of the storefront's architectural features and physical condition will help determine the best course of action in the actual rehabilitation work. The following recommendations, adapted from the Secretary of the Interior's "Standards for Rehabilitation" and the accompanying interpretive guidelines, are designed to ensure that the historic commercial character of the building is retained in the rehabilitation process.

If the original or significant storefront exists, repair and retain the historic features using recommended treatments (see following sections on rehabilitating metal, wood and masonry storefronts as well as the guidelines for rehabilitating existing historic storefronts found on page 3).

If the original or significant storefront no longer exists or is too deteriorated to save, undertake a contemporary design which is compatible with the rest of the building in scale, design, materials, color and texture; or undertake an accurate restoration based on historical research and physical evidence (see section on "Replacement Storefronts"). Where an original or significant storefront no longer exists and *no* evidence exists to document its early appearance, it is generally preferable to undertake a contemporary design that retains the commercial "flavor" of the building. The new storefront design should not draw attention away from the historic building with its detailing but rather should respect the existing historic character of the overall building. A new design that copies traditional details or features from neighboring buildings or other structures of the period may give the building a historical appearance which blends in with its neighbors but which never, in fact, existed. For this reason, use of conjectural designs, even if based on similar buildings elsewhere in the neighborhood or the availability of different architectural elements from other buildings or structures, is generally not recommended.

Rehabilitating Metal Storefronts

Rehabilitating metal storefronts can be a complex and time-consuming task. Before steps are taken to analyze or treat deteriorated storefronts, it is necessary to know which metal is involved, because each has unique properties and distinct preservation treatments. Storefronts were fabricated using a variety of metals, including cast iron, bronze, copper, tin, galvanized sheet iron, cast zinc, and stainless steel. Determining metallic composition can be a difficult process especially if components are encrusted with paint. Original architect's specifications (sometimes available from permit offices, town halls, or records of the original owner) can be important clues in this regard and should be checked if at all possible.

Iron—a magnetic, gray-white malleable metal, readily susceptible to oxidation. Cast iron, most commonly found in storefronts, is shaped by molds and can withstand great compressive loads. Rolled sheet iron, sometimes galvanized with zinc, also was used in storefront construction. Stainless steel began to appear in storefronts after 1930.

Zinc—a medium-hard, bluish-white metal, widely used as a protective coating for iron and steel. It is softer than iron and is nonmagnetic.

Copper—a nonmagnetic, corrosion-resistant, malleable metal, initially reddish-brown but when exposed to the atmosphere turns brown to black to green.

Bronze and brass—nonmagnetic, abrasive-resistant alloys combining copper with varying amounts of zinc, lead, or tin. These copper alloys, more commonly found in office buildings or large department stores, range in color from lemon yellow to golden brown to green depending on their composition and are well suited for casting (see figure 7).

Aluminum—a lightweight, nonmagnetic metal commonly found on storefronts dating from the 1920's and 30's. Its brightness and resistance to corrosion has made it a popular storefront material in the 20th century.



Figure 7. Part of a large office building constructed in Washington, D.C. in 1928, this finely detailed bronze storefront is typical of many constructed during this period. It should be noted that the original grilles, spandrel panel and window above are all intact. Photo: David W. Look, AIA

Repair and Replacement of Metal

Simply because single components of a storefront need repair or replacement should not be justification for replacing an entire storefront. Deteriorated metal architectural elements can be repaired by a variety of means, although the nature of the repair will depend on the extent of the deterioration, the type of metal and its location, and the overall cost of such repairs. Patches can be used to mend, cover or fill a deteriorated area. Such patches should be a close match to the original material to prevent galvanic corrosion. Splicing—replacement of a small section with new material—should be undertaken on structural members only when temporary bracing has been constructed to carry the load. Reinforcing—or bracing the damaged element with additional new metal material—can relieve fatigue or overloading in some situations.

If metal components have deteriorated to a point where they have actually failed (or are missing), replacement is the only reasonable course of action. If the components are significant to the overall design of the storefront, they should be carefully removed and substituted with components that match the original in material, size and detailing (see figure 8).



Figure 8. When the Grand Opera House in Wilmington, Delaware, was rehabilitated, missing cast-iron columns were cast of aluminum to match the original; in this particular case, because these columns do not carry great loads, aluminum proved to be successful substitute. Photo: John G. Waite

Before going to the expense of reproducing the original, it may be useful to check salvage yards for compatible components. Missing parts of cast iron storefronts can be replaced by new cast iron members that are reproductions of the original. New wooden patterns, however, usually need to be made if the members are large. This procedure tends to be expensive (it is usually impossible to use existing iron components as patterns to cast large elements because cast iron shrinks 1/5 inch per foot as it cools). In some situations, less expensive substitute materials such as aluminum, wood, plastics, and fiberglass, painted to match the metal, can be used without compromising the architectural character of the resource.

Cleaning and Painting

Cast iron storefronts are usually encrusted with layers of paint which need to be removed to restore crispness to the details. Where paint build-up and rust are not severe

problems, handscraping and wire-brushing are viable cleaning methods. While it is necessary to remove all rust before repainting, it is not necessary to remove all paint. For situations involving extensive paint build-up and corrosion, mechanical methods such as low-pressure gentle dry grit blasting (80-100 psi) can be effective and economical, providing a good surface for paint. Masonry and wood surfaces adjacent to the cleaning area, however, should be protected to avoid inadvertent damage from the blasting. It will be necessary to recaulk and putty the heads of screws and bolts after grit blasting to prevent moisture from entering the joints. Cleaned areas should be painted immediately after cleaning with a rust-inhibiting primer to prevent new corrosion. Before any cleaning is undertaken, local codes should be checked to ensure compliance with environmental safety requirements.

Storefronts utilizing softer metals (lead, tin), sheet metals (sheet copper), and plated metals (tin andterneplate) should not be cleaned mechanically (grit blasting) because their plating or finish can be easily abraded and damaged. It is usually preferable to clean these softer metals with a chemical (acid pickling or phosphate dipping) method. Once the surface of the metal has been cleaned of all corrosion, grease, and dirt, a rust-inhibiting primer coat should be applied. Finish coats especially formulated for metals, consisting of lacquers, varnishes, enamels or special coatings, can be applied once the primer has dried. Primer and finish coats should be selected for chemical compatibility with the particular metal in question.

Bronze storefronts, common to large commercial office buildings and major department stores of the 20th century, can be cleaned by a variety of methods; since all cleaning removes some surface metal and patina, it should be undertaken only with good reason (such as the need to remove encrusted salts, bird droppings or dirt). Excessive cleaning can remove the texture and finish of the metal. Since this patina can protect the bronze from further corrosion, it should be retained if possible. If it is desirable to remove the patina to restore the original surface of the bronze, several cleaning methods can be used: chemical compounds including rottenstone and oil, whitening and ammonia, or precipitated chalk and ammonia, can be rubbed onto bronze surfaces with a soft, clean cloth with little or no damage. A number of commercial cleaning companies successfully use a combination of 5% oxalic acid solution together with finely ground India pumice powder. Fine glass-bead blasting (or peening) and crushed walnut shell blasting also can be acceptable mechanical methods if carried out in controlled circumstances under low (80-100 psi) pressure. Care should be taken to protect any adjacent wood or masonry from the blasting.

The proper cleaning of metal storefronts should not be considered a "do-it-yourself" project. The nature and condition of the material should be assessed by a competent professional, and the work accomplished by a company specializing in such work.

Rehabilitating Wooden Storefronts

The key to the successful rehabilitation of wooden storefronts is a careful evaluation of existing physical conditions. Moisture, vandalism, insect attack, and lack of maintenance can all contribute to the deterioration of wooden storefronts. Paint failure should not be mistaken-

ly interpreted as a sign that the wood is in poor condition and therefore irreparable. Wood is frequently in sound physical condition beneath unsightly paint. An ice pick or awl may be used to test wood for soundness—decayed wood that is jabbed will lift up in short irregular pieces; sound wood will separate in long fibrous splinters.

Repair and Replacement of Wood

Storefronts showing signs of physical deterioration can often be repaired using simple methods. Partially decayed wood can be patched, built up, chemically treated or consolidated and then painted to achieve a sound condition, good appearance, and greatly extended life.

To repair wood showing signs of rot, it is advisable to dry the wood; carefully apply a fungicide such as pentachlorophenol (a highly toxic substance) to all decayed areas; then treat with 2 or 3 applications of boiled linseed oil (24 hours between applications). Afterward, fill cracks and holes with putty; caulk the joints between the various wooden members; and finally prime and paint the surface.

Partially decayed wood may also be strengthened and stabilized by consolidation, using semi-rigid epoxies which saturate porous decayed wood and then harden. The consolidated wood can then be filled with a semi-rigid epoxy patching compound, sanded and painted. More information on epoxies can be found in the publication "Epoxies for Wood Repairs in Historic Buildings," cited in the bibliography.

Where components of wood storefronts are so badly deteriorated that they cannot be stabilized, it is possible to replace the deteriorated parts with new pieces (see figure 9). These techniques all require skill and some expense, but are recommended in cases where decorative elements, such as brackets or pilasters, are involved. In some cases, missing edges can be filled and rebuilt using wood putty or epoxy compounds. When the epoxy cures, it can be sanded smooth and painted to achieve a durable and waterproof repair.



Figure 9. Rather than replace an entire wooden storefront when there is only localized deterioration, a new wooden component can be pieced-in, as seen here in this column base. The new wood will need to be given primer and top coats of a high quality exterior paint—either an oil-base or latex system. Also wood that is flaking and peeling should be scraped and hand-sanded prior to repainting. Photo: H. Ward Jandl

Repainting of Wood

Wooden storefronts were historically painted to deter the harmful effects of weathering (moisture, ultraviolet rays from the sun, wind, etc.) as well as to define and accent architectural features. Repainting exterior woodwork is thus an inexpensive way to provide continued protection from weathering and to give a fresh appearance to the storefront.

Before repainting, however, a careful inspection of all painted wood surfaces needs to be conducted in order to determine the extent of surface preparation necessary, that is, whether the existing layers of paint have deteriorated to the point that they will need to be partially or totally removed prior to applying the new paint.

As a general rule, removing paint from historic exterior woodwork should be avoided unless absolutely essential. Once conditions warranting removal have been identified, however, paint can be removed to the next sound layer using the gentlest method possible, then the woodwork repainted. For example, such conditions as mildewing, excessive chalking, or staining (from the oxidization of rusting nails or metal anchorage devices) generally require only thorough surface cleaning prior to repainting. Intercoat peeling, solvent blistering, and wrinkling require removal of the affected layer using mild abrasive methods such as hand scraping and sanding. In all of these cases of limited paint deterioration, after proper surface preparation the exterior woodwork may be given one or more coats of a high quality exterior oil finish paint.

On the other hand, if painted wood surfaces display continuous patterns of deep cracks or if they are extensively blistering and peeling so that bare wood is visible, the old paint should be completely removed before repainting. (It should be emphasized that because peeling to bare wood—the most common type of paint problem—is most often caused by excess interior or exterior moisture that collects behind the paint film, the first step in treating peeling is to locate and remove the source or sources of moisture. If this is not done, the new paint will simply peel off.)

There are several acceptable methods for total paint removal, depending on the particular wooden element involved. They include such thermal devices as an electric heat plate with scraper for flat surfaces such as siding, window sills, and doors or an electric hot-air gun with profiled scraper for solid decorative elements such as gingerbread or molding. Chemical methods play a more limited, supplemental role in removing paint from historic exterior woodwork; for example, caustic or solvent-base strippers may be used to remove paint from window muntins because thermal devices can easily break the glass. Detachable wooden elements such as exterior shutters, balusters and columns, can probably best be stripped by means of immersion in commercial dip tanks because other methods are too laborious. Care must be taken in rinsing all chemical residue off the wood prior to painting or the new paint will not adhere.

Finally, if the exterior woodwork has been stripped to bare wood, priming should take place within 48 hours (unless the wood is wet, in which case it should be permitted to dry before painting). Application of a high quality oil type exterior primer will provide a surface over which either an oil or latex top coat can be successfully used.

Rehabilitating Masonry Storefronts

Some storefronts are constructed of brick or stone, and like their metal and wooden counterparts, also may have been subjected to physical damage or alterations over time. Although mortar may have disintegrated, inappropriate surface coatings applied, and openings reduced or blocked up, careful rehabilitation will help restore the visual and physical integrity of the masonry storefront.

Repair and Replacement of Masonry

If obvious signs of deterioration—disintegrating mortar, spalling bricks or stone—are present, the causes (ground moisture, leaky downspouts, etc.) should be identified and corrected. Some repointing may be necessary on the masonry surface, but should be limited to areas in which so much mortar is missing that water accumulates in the mortar joints, causing further deterioration. New mortar should duplicate the composition, color, texture, and hardness, as well as the joint size and profile of the original. Badly spalling bricks may have to be replaced. Deteriorated stone may be replaced in kind, or with a matching substitute material; in some cases where not visually prominent, it may be covered with stucco, possibly scored to resemble blocks of stone.

Cleaning Masonry

Inappropriate cleaning techniques can be a major source of damage to historic masonry buildings. Historic masonry should be cleaned only when necessary to halt deterioration or to remove graffiti and stains, and always with the gentlest means possible, such as water and a mild detergent using natural bristle brushes, and/or a non-harmful chemical solution, both followed by a low-pressure water rinse.

It is important to remember that many mid-19th century brick buildings were painted immediately or soon after construction to protect poor quality brick or to imitate stone. Some historic masonry buildings not originally painted were painted at a later date to hide alterations or repairs, or to solve recurring maintenance or moisture problems. Thus, whether for reasons of historical tradition or practicality, it may be preferable to retain existing paint. If it is readily apparent that paint is not historic and is a later, perhaps unsightly or inappropriate treatment, removal may be attempted, but only if this can be carried out without damaging the historic masonry. Generally, paint removal from historic masonry may be accomplished successfully only with the use of specially formulated chemical paint removers. No abrasive techniques, such as wet or dry sandblasting should be considered. If non-historic paint cannot be removed without using abrasive methods, it is best to leave the masonry painted, although repainting in a compatible color may help visually.

Removing unsightly mastic from masonry presents a similarly serious problem. Its removal by mechanical means may result in abrading the masonry, and chemical and heat methods may prove ineffective, although solvents like acetone will aid in softening the hardened mastic. If the mastic has become brittle, a flat chisel may be used to pop it off; but this technique, if not undertaken with care, may result in damaging the masonry. And even if total removal is possible, the mastic may have permanently stained the masonry. Replacement of these masonry sec-

tions marred by mastic application may be one option in limited situations; individual pieces of stone or bricks that have been damaged by inappropriate alterations may be cut out and replaced with new pieces that duplicate the original. However, since an exact match will be nearly impossible to achieve, it may be necessary to paint the repaired masonry in order to create a harmonious facade. Replacement of a large area with new materials may not be acceptable as it may give the building a new, non-historic appearance inappropriate to the building style and period.

Designing Replacement Storefronts

Where an architecturally or historically significant storefront no longer exists or is too deteriorated to save, a new front should be designed which is compatible with the size, scale, color, material, and character of the building. Such a design should be undertaken based on a thorough understanding of the building's architecture and, where appropriate, the surrounding streetscape (see figure 10). For example, just because upper floor windows are arched is not sufficient justification for designing arched openings for the new storefront. The new design should "read" as a storefront; filling in the space with brick or similar solid material is inappropriate for historic buildings. Similarly the creation of an arcade or other new design element, which alters the architectural and historic character of the building and its relationship with the street, should be avoided. The guidelines on page 8 can assist in developing replacement storefront designs that respect the historic character of the building yet meet current economic and code requirements.

Guidelines for Designing Replacement Storefronts

1. *Scale:* Respect the scale and proportion of the existing building in the new storefront design.
2. *Materials:* Select construction materials that are appropriate to the storefronts; wood, cast iron, and glass are usually more appropriate replacement materials than masonry which tends to give a massive appearance.
3. *Cornice:* Respect the horizontal separation between the storefront and the upper stories. A cornice or fascia board traditionally helped contain the store's sign.
4. *Frame:* Maintain the historic planar relationship of the storefront to the facade of the building and the streetscape (if appropriate). Most storefront frames are generally composed of horizontal and vertical elements.
5. *Entrances:* Differentiate the primary retail entrance from the secondary access to upper floors. In order to meet current code requirements, out-swinging doors generally must be recessed. Entrances should be placed where there were entrances historically, especially when echoed by architectural detailing (a pediment or projecting bay) on the upper stories.
6. *Windows:* The storefront generally should be as transparent as possible. Use of glass in doors, transoms, and display areas allows for visibility into and out of the store.
7. *Secondary Design Elements:* Keep the treatment of secondary design elements such as graphics and awnings as simple as possible in order to avoid visual clutter to the building and its streetscape.

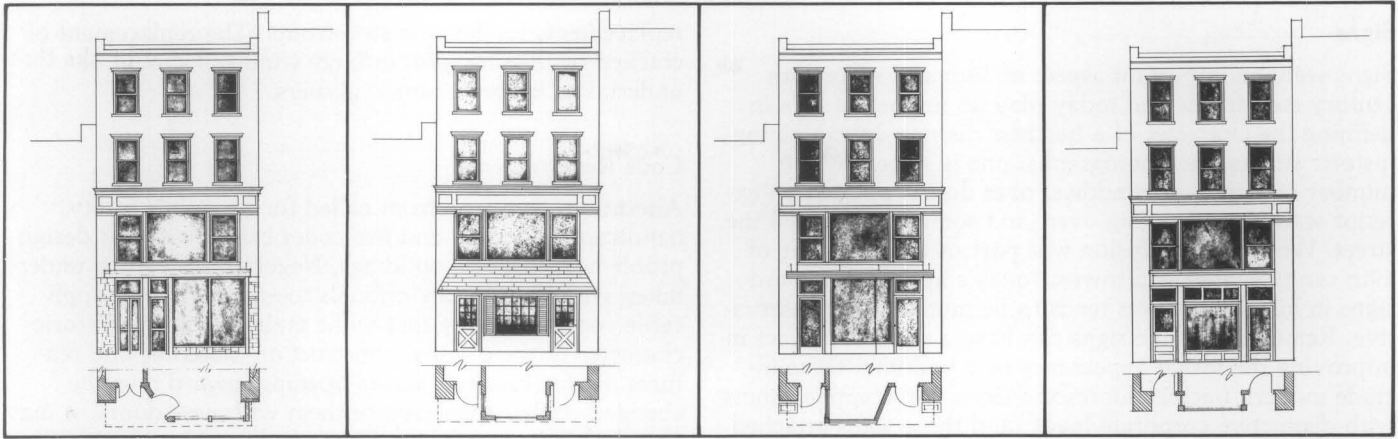


Figure 10. (A) This existing storefront, added in the 1950's to a late 19th century brick building, extends beyond the plane of the facade; faced with anodized aluminum and permastone, it does not contribute to the architectural and historic character of the building. (B) This replacement design uses "lumberyard colonial" detailing, such as barn-type doors, shutters, small paned windows, and a wood shake pent roof. The design, detailing, and choice of materials are clearly inappropriate to this commercial building. (C) This replacement design retains the 1950's projecting canopy but symmetrical placement of the doors relates well to the second floor windows above; this contemporary design is compatible with the scale and character of the building. (D) This replacement design accurately restores the original appearance of the building; based on historical research and physical evidence, it too is an acceptable preservation approach. Drawings: Sharon C. Park, AIA

A restoration program requires thorough documentation of the historic development of the building prior to initiating work. If a restoration of the original storefront is contemplated, old photographs and prints, as well as physical evidence, should be used in determining the form and details of the original. Because storefronts are particularly susceptible to alteration in response to changing marketing techniques, it is worthwhile to find visual documentation from a variety of periods to have a clear understanding of the evolution of the storefront. Removal of later additions that contribute to the character of the building should not be undertaken.

Other Considerations

Pigmented Structural Glass

The rehabilitation of pigmented structural glass storefronts, common in the 1930's, is a delicate and often frustrating task, due to the fragility and scarcity of the material. Typically the glass was installed against masonry walls with asphaltic mastic and a system of metal shelf angles bolted to the walls on three-foot centers. Joints between the panels were filled with cork tape or an elastic joint cement to cushion movement and prevent moisture infiltration.

The decision to repair or replace damaged glass panels should be made on a case-by-case basis. In some instances, the damage may be so minor or the likelihood of finding replacement glass so small, that repairing, reanchoring and/or stabilizing the damaged glass panel may be the only prudent choice. If the panel is totally destroyed or missing, it may be possible to replace with glass salvaged from a demolition; or a substitute material, such as "spandrel glass," which approximates the appearance of the original. Although pigmented structural glass is no longer readily available, occasionally long-established glass "jobbers" will have a limited supply to repair historic storefronts.

Awnings

Where based on historic precedent, consider the use of canvas awnings on historic storefronts (see figure 11).

Awnings can help shelter passersby, reduce glare, and conserve energy by controlling the amount of sunlight hitting the store window, although buildings with northern exposures will seldom functionally require them. Today's canvas awnings have an average life expectancy of between 4 and 7 years. In many cases awnings can disguise, in an inexpensive manner, later inappropriate alterations and can provide both additional color and a strong store identification. Fixed aluminum awnings and awnings simulating mansard roofs and umbrellas are generally inappropriate for older commercial buildings. If awnings are added, choose those that are made from soft canvas or vinyl materials rather than wood or metal; be certain that they are installed without damaging the building or visually impairing distinctive architectural features and can be operable for maximum energy conservation effect.

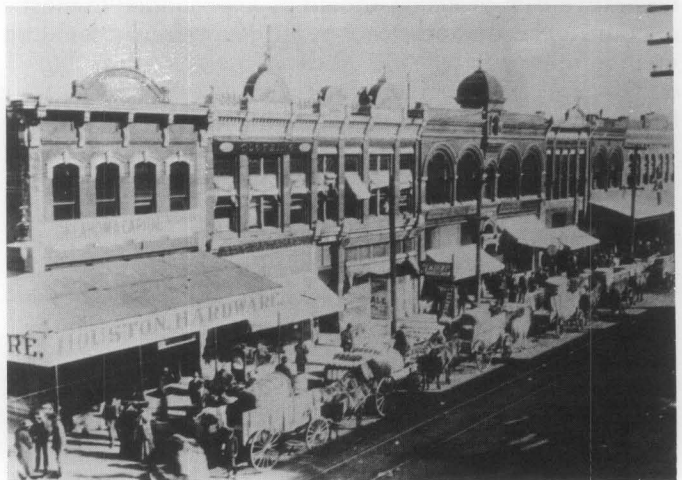


Figure 11. Try to locate old photographs or prints to determine what alterations have been made to the storefront and when they were undertaken. Awnings were common elements of storefronts at the turn of the century. They can be equally useful today.

Signs

Signs were an important aspect of 19th and early 20th century storefronts and today play an important role in defining the character of a business district. In examining historic streetscape photographs, one is struck by the number of signs—in windows, over doors, painted on exterior walls, and hanging over (and sometimes across) the street. While this confusion was part of the character of 19th century cities and towns, today's approach toward signs in historic districts tends to be much more conservative. Removal of some signs can have a dramatic effect in improving the visual appearance of a building; these include modern backlit fluorescent signs, large applied signs with distinctive corporate logos, and those signs attached to a building in such a way as to obscure significant architectural detailing. For this reason, their removal is encouraged in the process of rehabilitation. If new signs are designed, they should be of a size and style compatible with the historic building and should not cover or obscure significant architectural detailing or features. For many 19th century buildings, it was common to mount signs on the lintel above the first story. Another common approach, especially at the turn of the century, was to paint signs directly on the inside of the display windows. Frequently this was done in gold leaf. New hanging signs may be appropriate for historic commercial buildings, if they are of a scale and design compatible with the historic buildings. Retention of signs and advertising painted on historic walls, if of historic or artistic interest (especially where they provide evidence of early or original occupants), is encouraged.

Paint Color

Paint analysis can reveal the storefront's historic paint colors and may be worth undertaking if a careful restoration is desired. If not, the paint color should be, at a minimum, appropriate to the style and setting of the building. This also means that if the building is in a historic district, the color selection should complement the building in question as well as other buildings in the block. In general, color schemes for wall and major decorative trim or details should be kept simple; in most cases the color or colors chosen for a storefront should be used on other painted exterior detailing (windows, shutter, cornice, etc.) to unify upper and lower portions of the facade.

Windows

Glass windows are generally the most prominent features in historic storefronts, and care should be taken to ensure that they are properly maintained. For smaller paned windows with wooden frames, deteriorated putty should be removed manually, taking care not to damage wood along the rabbet. To reglaze, a bead of linseed oil-based putty should be laid around the perimeter of the rabbet; the glass pane pressed into place; glazing points inserted to hold the pane; and a final seal of putty beveled around the edge of the glass. For metal framed windows, glazing compound and special glazing clips are used to secure the glass; a final seal of glazing compound then is often applied. If the glass needs replacing, the new glass should match the original in size, color and reflective qualities. Mirrored or tinted glass are generally inappropriate

replacements for historic storefronts. The replacement of cracked or missing glass in large windows should be undertaken by professional glaziers.

Code Requirements

Alterations to a storefront called for by public safety, handicapped access, and fire codes can be difficult design problems in historic buildings. Negotiations can be undertaken with appropriate officials to ensure that all applicable codes are being met while maintaining the historic character of the original construction materials and features. If, for instance, doors opening inward must be changed, rather than replace them with new doors, it may be possible to reverse the hinges and stops so that they will swing outward.

Summary

A key to the successful rehabilitation of historic commercial buildings is the sensitive treatment of the first floor itself (see figure 12). Wherever possible, significant storefronts (be they original or later alterations), including windows, sash, doors, transoms, signs and decorative features, should be repaired in order to retain the historic character of the building. Where original or early storefronts no longer exist or are too deteriorated to save, the commercial character of the building should nonetheless be preserved—either through an accurate restoration based on historic research and physical evidence or a contemporary design which is compatible with the scale, design, materials, color and texture of the historic building. The sensitive rehabilitation of historic storefronts will not only enhance the architectural character of the overall building but will contribute to rejuvenating neighborhoods or business districts as well.



Figure 12. This photograph of three late 19th century commercial buildings clearly shows the impact of preserving and rehabilitating storefronts. The one on the right has been totally obscured by a "modern" front added in the 1950's. Although inappropriate alterations have taken place on the left storefront, it is still possible to determine the original configuration of the doors and display windows. The storefront in the middle has remained intact. Although in need of some minor maintenance work, the appeal of the original design and materials is immediately apparent.

Additional Reading

- Bryan, John M. and the Triad Architectural Associates. *Abbeville, South Carolina: Using Grant-in-Aid Funds for Rehabilitation Planning and Project Work in the Commercial Town Square*. Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Gayle, Margot and Edmund V. Gillon, Jr. *Cast Iron Architecture in New York*. New York: Dover Publications, Inc., 1971.
- Gayle, Margot and David W. Look and John G. Waite. *Metals in America's Historic Buildings: Uses and Preservation Treatments*. Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Gelbloom, Mara. "Old Storefronts." *The Old-House Journal* VI, No. 3 (March 1978), pp. 25-34.
- Grimmer, Anne E. "Dangers of Abrasive Cleaning to Historic Buildings." (Preservation Briefs 6), Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1979.
- Guthrie, Susan. *Main Street Historic District, Van Buren, Arkansas: Using Grant-in-Aid Funds for Storefront Rehabilitation*. Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Hartmann, Robert R. "Design for the Business District, Part I." Racine, Wisconsin: Racine Urban Aesthetics, Inc., 1979.
- Hensley, Tom. "The Preservation of Historic Pigmented Structural Glass (Vitrolite and Carraa Glass)." Denver: Rocky Mountain Regional Office, National Park Service, 1981.
- Marsh, Ellen. "An Introduction to Storefront Rehabilitation." *Conserve Neighborhoods*, No. 7 (Summer 1979).
- Mintz, Norman. "A Practical Guide to Storefront Rehabilitation." Technical Series No. 2.: Albany, N.Y.: Preservation League of New York State, 1977.
- Myers, John H. *The Repair of Historic Wooden Windows*. (Preservation Briefs 9). Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Park, Sharon C. *Storefront Rehabilitation: A 19th Century Commercial Building*. Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Phillips, Morgan W. and Dr. Judith E. Selwyn. "Epoxies for Wood Repairs in Historic Buildings." Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1978.
- Rifkind, Carole. *Main Street: The Face of Urban America*. New York: Harper and Row, 1977.
- The Secretary of the Interior's Standards for Rehabilitation and Guidelines for Rehabilitating Historic Buildings*. Washington, D.C.: Technical Preservation Services Division, U.S. Department of the Interior, 1980.
- Weeks, Kay D. and David W. Look. "Exterior Paint Problems on Historic Woodwork." (Preservation Briefs 10). Washington, D.C.: Technical Preservation Services, U.S. Department of the Interior, 1982.

Special thanks go to Kay D. Weeks and Sharon C. Park, AIA, for providing technical and editorial direction in the development of this Preservation Brief. The following individuals are also to be thanked for reviewing the manuscript and making suggestions: Norman Mintz, New York, N.Y.; Judith Kitchen, Columbus, Ohio; Jim Vaseff, Atlanta, Georgia; and Tom Moriarity, Washington, D.C. Finally thanks go to Technical Preservation Service Branch staff members, especially Martha A. Gutrick, Michael J. Auer and Anne E. Grimmer, whose valuable comments were incorporated into the final text and who contributed to the publication of the brief.

This publication has been prepared pursuant to the Economic Recovery Tax Act of 1981 which directs the Secretary of the Interior to certify rehabilitations of historic buildings that are consistent with their historic character; the advice and guidance provided in this brief will assist property owners in complying with the requirements of this law.

Preservation Briefs 11 has been developed under the technical editorship of Lee H. Nelson, AIA, Chief, Preservation Assistance Division, National Park Service, U.S. Department of the Interior, Washington, D.C. 20240. Comments on the usefulness of this information are welcomed and can be sent to Mr. Nelson at the above address.

This publication is not copyrighted and can be reproduced without penalty. Normal procedures for credit to the author and the National Park Service are appreciated.

Cover drawing: This woodcut of the Joy Building, built in 1808 in Boston, shows early storefronts with shutters; note the profusion of signs covering the facade, advertising the services of the tenants.

September 1982

For sale by the Superintendent of Documents, U.S. Government Printing Office
Washington, D.C. 20402

PARK STREET, 1339

(BUILT BEFORE 1909)

DATE	JOB	COST	PERMIT NO.	REMARKS
10-22-43	re-roofing	150.00	461	
9-30-10	alterations	300.00	785	
2-16-37	sign	200.00	58	
3-30-48	alter store	80.00	307	Owner: H. Kaliski
9-30-10	alteration	300.00	785	
2-6-50	sign	250.00	81	Sign #4
2-1-52	alterations	300.00	121	Owner: Mrs. Way
2-19-52	Sign	150.00	222	Sign #12
9-19-60	Sign	35.	1291-S	Owner: Mr. Konigshofer
2-16-65	Repair exterior	\$1,200.	224	
11-10-65	Remodeling	\$6,432.	1666	Plan #297A P.S.
12-28-66	Sign	\$ 150.	1630-S	H. R. Block Co.

Can you find out if the car is

Park St., 1339

7-8-80

Awning on storefront

\$570.00

80-0598

Tony Pizzira

*** C I T Y of A L A M E D A ***

Property Inquiry File

02/28/92

Permit Address: 1339 PARK ST

PERMIT/#	ISSUE DATE	FINAL DATE	CONTRACTOR	JOB	APT
BP-80-0598	07/08/80	/ /	ACME AWNING CO.	STORE FRONT AWNING	



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1339 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Final Date</u>
BP800598	Building Permit	FINAL	TONY PIZZE	07/08/1980	06/12/1998
Work Description: STORE FRONT AWNING					
P91-6181	Plumbing Permit	FINAL	DIANE COLERDARK	08/02/1991	03/20/1992
Work Description: PARK ST FAIRE-2 VAULT TOILETS					
C92-0311	Concrete Permit	FINAL	CITY OF ALAMEDA	05/28/1992	06/05/1992
Work Description: CONCRETE REPAIR WORK - TAG #9965					
B93-1487	Building Permit	FINAL	BEST CANVAS CO.	11/18/1993	06/24/1998
Work Description: INSTALL AWNINGS(1339 PARK/2321 ALA. AVE)					
P94-5899	Plumbing Permit	FINAL	"OLD FRIENDS" /R. SNAPE	01/26/1995	08/16/1996
Work Description: INSTALL SINKS/WATER HEATER FOR FUDGE SHP					
SN95-026	Miscellaneous Planning	FINAL	QUALITY SIGN & LIGHTING	05/23/1995	
Work Description:					



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1339 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Finaled Date</u>
CB12-0159	Combination Building Permit	Finaled	HEATHER RIDER	04/12/2012	08/21/2012
Work Description: MONKEY BARS CHILDREN'S STORE - REMOVAL OF AN EXISTING CANVAS AWNING & REPLACEMENT WITH A NEW ALUMINUM, WOOD & GLASS CUSTOM AWNING/SIGN (BLDG/ELEC)					
EN12-0050	Encroachment Permit	Finaled	LEE TOLLEFSRUD	04/19/2012	08/23/2012
Work Description: MONKEY BARS CHILDREN STORE - INSTALLATION OF SCAFFOLDING ON SIDEWALK FOR PAINTING OF BUILDING (APPROX. 3 WEEKS)					
EN12-0073	Encroachment Permit	Finaled	LEE TOLLEFSRUD	05/21/2012	05/25/2012
Work Description: NO PARKING - LEE TOLLEFSRUD - 1 SPACE AT 1339 PARK ST ON 5/23/12 FROM 8AM UNTIL 12PM (FOR CONSTRUCTION)					
EN12-0074	Encroachment Permit	Finaled	LEE TOLLEFSRUD	05/21/2012	05/30/2012
Work Description: NO PARKING - LEE TOLLEFSRUD - 1 SPACE AT 1339 PARK ST ON 5/29/12 FROM 8AM UNTIL 12PM (FOR CONSTRUCTION) ***ISSUED ONE MORE SIGN BECAUSE PREVIOUS GOLD STOLEN 5/23/12 LA***					
EN12-0084	Encroachment Permit	Finaled	LEE TOLLEFSRUD	06/07/2012	06/18/2012
Work Description: NO PARKING - LEE TOLLEFSRUD - FOR CONSTRUCTION (2 SPACES) AT 1339 PARK ST ON 6/11/12 FROM 7AM UNTIL 3PM					
EN12-0085	Encroachment Permit	Finaled	LEE TOLLEFSRUD	06/07/2012	10/15/2012
Work Description: NO PARKING - LEE TOLLEFSRUD- FOR CONSTRUCTION (1 SPACE) AT 1339 PARK ST ON 6/20/12 FROM 8AM UNTIL 5PM					



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1339 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Finaled Date</u>
EN12-0090	Encroachment Permit	Finaled	LEE TOLLEFSRUD	06/14/2012	07/31/2012
Work Description: NO PARKING - LEE TOLLEFSRUD - CONSTRUCTION (1 SPACE) AT 1339 PARK ST- STARTING ON 6/19/12 UNTIL 6/29/12 FROM 7AM UNTIL 6PM					
EN12-0099	Encroachment Permit	Finaled	LEE TOLLEFSRUD	06/14/2012	08/02/2012
Work Description: NO PARKING - LEE TOLLEFSRUD - CONSTRUCTION (1 SPACE) AT 1339 PARK ST- STARTING ON 7/5/12 UNTIL 7/6/12 & 7/9/12 UNTIL 7/12/12 FROM 7AM UNTIL 9PM					
EN15-0348	Encroachment Permit	Issued	DANGERBOYS, LLC DBA CRIMINAL	12/09/2015	
Work Description: NO PARKING - DANGERBOYS, LLC DBA CRIMINAL - WILSON WU - FOR FILMING - 23 SPACES AT ALAMEDA AVENUE BETWEEN OAK AND PARK ST & 1335 PARK ST					
EX16-0095	Right-of-Way Permit	Issued	PIPE SPY INC	01/31/2017	
Work Description: RIGHT OF WAY PERMIT - FOR SEWER LATERAL REPAIR - EXCAVATION ACROSS SIDEWALK - ON PARK STREET & ALAMEDA AVENUE					
FS106-0082	Fire Safety	OK to Inspect			
Work Description: ANNUAL FIRE SAFETY INSPECTION					
PLN11-0243	Entitlement	Approved	Heather Reed (Monkey Bars)		



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1339 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Final Date</u>
Work Description: "Monkey Bars" SIGN AND AWNING					
PLN17-0080	Entitlement	Incomplete Subm	CHOLITA LINDA LLC		
Work Description: CERTIFICATE OF APPROVAL & DESIGN REVIEW - THE PROPOSED IMPROVEMENTS INCLUDED RESTORATION WORK AS WELL AS MODIFICATIONS TO EXISTING STOREFRONTS TO BRING THE COMMERCIAL SPACES INTO COMPLIANCE WITH CURRENT BUILDING CODE REQUIREMENTS. THE PROPERTY IS LOCATED WITHIN THE C-C (COMMUNITY COMMERCIAL) ZONING DISTRICT AND IS A CONTRIBUTING STRUCTURE WITHIN THE PARK STREET HISTORIC DISTRICT. THE PROJECT IS CATEGORICALLY EXEMPT FROM THE CALIFORNIA ENVIRONMENTAL QUALITY ACT (CEQA) PURSUANT TO CEQA GUIDELINES SECTION 15301- EXISTING FACILITIES					
X12-0122	Complaint	Compliance			
Work Description: WORK WITHOUT PERMIT; CONSTRUCTION NOISES SOUND LIKE THEY ARE COMING FROM ROOF PER R/P					
X17-0033	Complaint	In Violation			
Work Description: WORK WITHOUT PERMIT ON HISTORICAL BUILDING					

PARK STREET, 1337

5-4-76	Sign	\$350.00	#288	Robert E. Ell
7-11-79	Remodel	3,500.00	79-0827 att.	Perata/Piazza
8-24-79	Awnings	1,400.00	79-1012att	City Delicatessen

*** CITY of ALAMEDA ***

Property Inquiry File

02/28/92

Permit Address: 1337 PARK ST

PERMIT/#	ISSUE DATE	FINAL DATE	CONTRACTOR	JOB	APT
BP-84-0000	99/99/02	99/99/02	CMR INDUSTRIES	REMODEL DELI	



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1337 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Final Date</u>
B95-0529	Building Permit	FINAL	BEST CANVAS CO.	05/22/1995	06/23/1998
Work Description: T/I VILLAGE PIZZA-NEW CANVAS AWNING					
B95-0558	Building Permit	FINAL	QUALITY SIGN & LIGHTING	06/07/1995	06/15/1995
Work Description: SIGN ABOVE AWNING (VILLAGE PIZZA)					
B97-1918	Building Permit	EXPIRED	DON GRAVESTOCK	11/26/1997	
Work Description: AWNING & STORE FRONT WINDOW					
SN-98-01	Miscellaneous Planning	FINAL	PASCOON PROPERTY/VILLAGE CAFE	01/15/1998	
Work Description:					
EN00-065	Encroachment Permit	FINALED	ANTHONY BISKINS	05/17/2001	03/14/2002
Work Description: OUTSIDE CAFE-T/I VILLAGE PIZZA & CAFE (1 TABLE/2 CHAIRS)					
CB09-0701	Combination Building Permit	Expired	LEE'S SIGNS	10/12/2009	
Work Description: T/I FLAVORS OF INDIA ~ REMOVE (E) AWNING & REPLACE WITH ILLUMINATED BOX SIGN					



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1337 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Finaled Date</u>				
FS106-0084	Fire Safety	Initial Inspection I							
Work Description: ANNUAL FIRE SAFETY INSPECTION									
PLN09-0321	Entitlement	Approved	LEE'S SIGNS						
Work Description: FLAVORS OF INDIA:REMOVE AWNING & INSTALL NEW ILLUMINATED PUSH-THRU LETTERS AND LOGO SIGN ON FRAME SUPPORT ATTACHED TO BUILDING									
<table><tr><td>ENTITLEMENT</td><td>OUTCOME</td></tr><tr><td>Minor Design Review - Routed</td><td>Approved</td></tr></table>						ENTITLEMENT	OUTCOME	Minor Design Review - Routed	Approved
ENTITLEMENT	OUTCOME								
Minor Design Review - Routed	Approved								
PLN17-0009	Zoning Clearance	Approved	MURAT SOZERI						
Work Description: ZONING CLEARANCE - "CHOLITA LINDA" - RESTAURANT									
PLN17-0080	Entitlement	Incomplete Subm	CHOLITA LINDA LLC						
Work Description: CERTIFICATE OF APPOVAL & DESIGN REVIEW - THE PROPOSED IMPROVEMENTS INCLUDED RESTORATION WORK AS WELL AS MODIFICATIONS TO EXISTING STOREFRONTS TO BRING THE COMMERCIAL SPACES INTO COMPLIANCE WITH CURRENT BUILDING CODE REQUIREMENTS. THE PROPERTY IS LOCATED WITHIN THE C-C (COMMUNITY COMMERCIAL) ZONING DISTRICT AND IS A CONTRIBUTING STRUCTURE WITHIN THE PARK STREET HISTORIC DISTRICT. THE PROJECT IS CATEGORICALLY EXEMPT FROM THE CALIFORNIA ENVIRONMENTAL QUALITY ACT (CEQA) PURSUANT TO CEQA GUIDELINES SECTION 15301- EXISTING FACILITIES									



CITY OF ALAMEDA
2263 SANTA CLARA AVENUE, ROOM 190
ALAMEDA, CA 94501

(510) 747-6800
FAX (510) 747-6804

PERMIT HISTORY REPORT
Activity at: 1337 PARK

<u>Permit</u>	<u>Type</u>	<u>Status</u>	<u>Applicant</u>	<u>Issued Date</u>	<u>Finished Date</u>
UR07-0377	Urban Runoff	OK to Inspect			
Work Description: STORM WATER INSPECTION					
X00-0081	Complaint	INVALID	CITY OF ALAMEDA		
Work Description: A FRAME SIGNS					
X10-0337	Complaint	Referred			
Work Description: FLAVORS OF INDIA HAS BEEN ILLEGALLY DUMPING GREASE, OIL, FOOD BITS, AND CLEANING SOLVENTS INTO GUTTERS THAT DRAINS TO THE BAY REC'D 9/8/10					

PARK ST., 1335

ORIGINAL PLANS FOR MARTI RAE APARTMENTS FILED IN ATTIC

Owner- L. Kaliski

Bldr.- Conrad Roth

1-17-25 stores & Apt.s 25,000.00

DATE	JOB	COST	PERMIT NO.	REMARKS
------	-----	------	------------	---------

8-3-43	alteration	500.00	319	
--------	------------	--------	-----	--

9-21-51	reroofing	845.00	850	Owner: Mrs. M. Way
---------	-----------	--------	-----	--------------------

1-5-66	2 signs	\$ 900.00	14-S	Plan #5A P.S.
--------	---------	-----------	------	---------------

2-23-76	Sign	\$1,500.00	118	plans att. Pacific Finance
---------	------	------------	-----	----------------------------

6-3-80	install sign	600.00	80-0504	Owner: George Britt
--------	--------------	--------	---------	---------------------